



A GREENCAP
CONSULTING COMPANY

Risk Management Services

NOEL ARNOLD & ASSOCIATES PTY LTD
A.C.N. 006 318 010 A.B.N. 75 006 318 010
Level 2, 11 Khartoum Road,
North Ryde, NSW 2113 Australia
Phone: (02) 9889 1800
Fax: (02) 9889 1811
Email: sydney@noel-arnold.com.au
www.noel-arnold.com.au


ASBESTOS FIBRE AIR MONITORING REPORT

Our Ref: C107605:J111804 043-20130225
Client: Hanson Construction Materials Pty Ltd
Attention: Martin Gear - Project Manager Aggregates
Job Location: East Guyong Quarry, Mitchell Highway, East Guyong NSW
Report Date: Monday 25 February 2013 Test Date: Monday 25 February 2013
Sampling Procedure: Control Sampled By: Pumps On: SB
Pumps Off: SB

Method: *Filters examined in accordance with Safe Work Australia's Guidance Note on the Membrane Filter Method for the Estimation of Airborne Asbestos Fibres, 2nd Edition, 2005 [NOHSC:3003: (2005)] – Refer NAA Internal Laboratory Test Method NALAB 301.*

Filter No.	Test Type Sample Location	Sample Period Start-Finish	Average Flow Rate (L/min)	Fibres/ Fields	Result(s) Fibres/mL
Control static monitoring during excavation works at the northern end of the new access road and the NW section of the Infrastructure Area on the East Guyong Quarry Site					
473	Field Blank	-	-	0.0/100	-
417	Location 1 – Near Southern Boundary of Site, Access Road to Residence (No.3472) off Mitchell Highway, approx. 120 metres North of South Site Boundary – On barbed wire fence	0934 – 1556	1.20	0.0/100	< 0.01
2023	Location 3 – Near Southern Boundary (SE Corner) of Site, Adjacent to New Access Road Entry (No.3410) off Mitchell Highway, approx. 30 metres from South Site Boundary – On barbed wire fence	0942 – 1600	1.20	0.0/100	< 0.01
2229	Location 4 – Near Eastern Boundary (near SE Corner) of Site, approx. 70 metres West of Shed, Access Road – On barbed wire fence	0944 – 1603	1.20	0.0/100	< 0.01
689	Location 5 – Near Eastern Boundary (near Centre) of Site, approx. 50 metres West of East Site Boundary – On fencing post	0946 – 1612	1.20	1.0/100	< 0.01
823	Location 6 – Western Boundary of Proposed Quarry Pit (near Western Site Boundary) – On barbed wire fence	1010 – 1629	1.20	0.0/100	< 0.01
614	Location 8 – Western Boundary (near NW Corner) of Site – On barbed wire fence	1015 – 1629	1.20	0.0/100	< 0.01
2160	Location 10 – Near Northern Boundary of Site (near NE Corner Site) – On fencing post	0758 – 1540	1.20	0.0/100	< 0.01

Filter No.	Test Type Sample Location	Sample Period Start-Finish	Average Flow Rate (L/min)	Fibres/ Fields	Result(s) Fibres/mL
2140	Location N1 – West of Work Area (approx. 15 metres west of new access road cutting) – On barbed wire fence	0958 – 1620	1.20	0.0/100	< 0.01
613	Location N2 – East of Work Area (approx. 15 metres east of new access road cutting) – On barbed wire fence	0950 – 1620	1.20	1.0/100	< 0.01
1032	Location N3 – South of Work Area (south end of new access road cutting) – On barbed wire fence	1104 – 1703	1.20	0.0/100	< 0.01
1000	Location N4 – South of Work Area (NW section of Infrastructure Area) – On fence post	1038 – 1646	1.20	0.0/100	< 0.01
2111	Location N5 – West of Work Area (NW section of Infrastructure Area) – On barbed wire fence	1042 – 1648	1.20	0.0/100	< 0.01
934A	Location N6 – North of Work Area (NW section of Infrastructure Area) – On fence post	1046 – 1652	1.20	0.0/100	< 0.01
743	Location N7 – East of Work Area (NW section of Infrastructure Area) – On fence post	1056 – 1656	1.20	1.0/100	< 0.01
Exposure monitoring during excavation works					
2206	John Willis – Excavator Operator (EODO) (NW corner of Infrastructure Area)	1003 – 1650	1.20	1.0/100	< 0.01
345	Marty Rookyard – Articulated Dump Truck Operator (EODO) (for new access road)	1100 – 1659	1.20	2.0/100	< 0.01



APPROVED COUNTER AND SIGNATORY :
SIMON BUTTERFIELD




This document is issued in accordance with NATA's accreditation requirements.

Accredited for compliance with ISO/IEC 17025. Corporate Site No. 5450, Site No. 3402 Sydney Laboratory.

This document shall not be reproduced, except in full.

Figure 1 – Air Monitoring Location

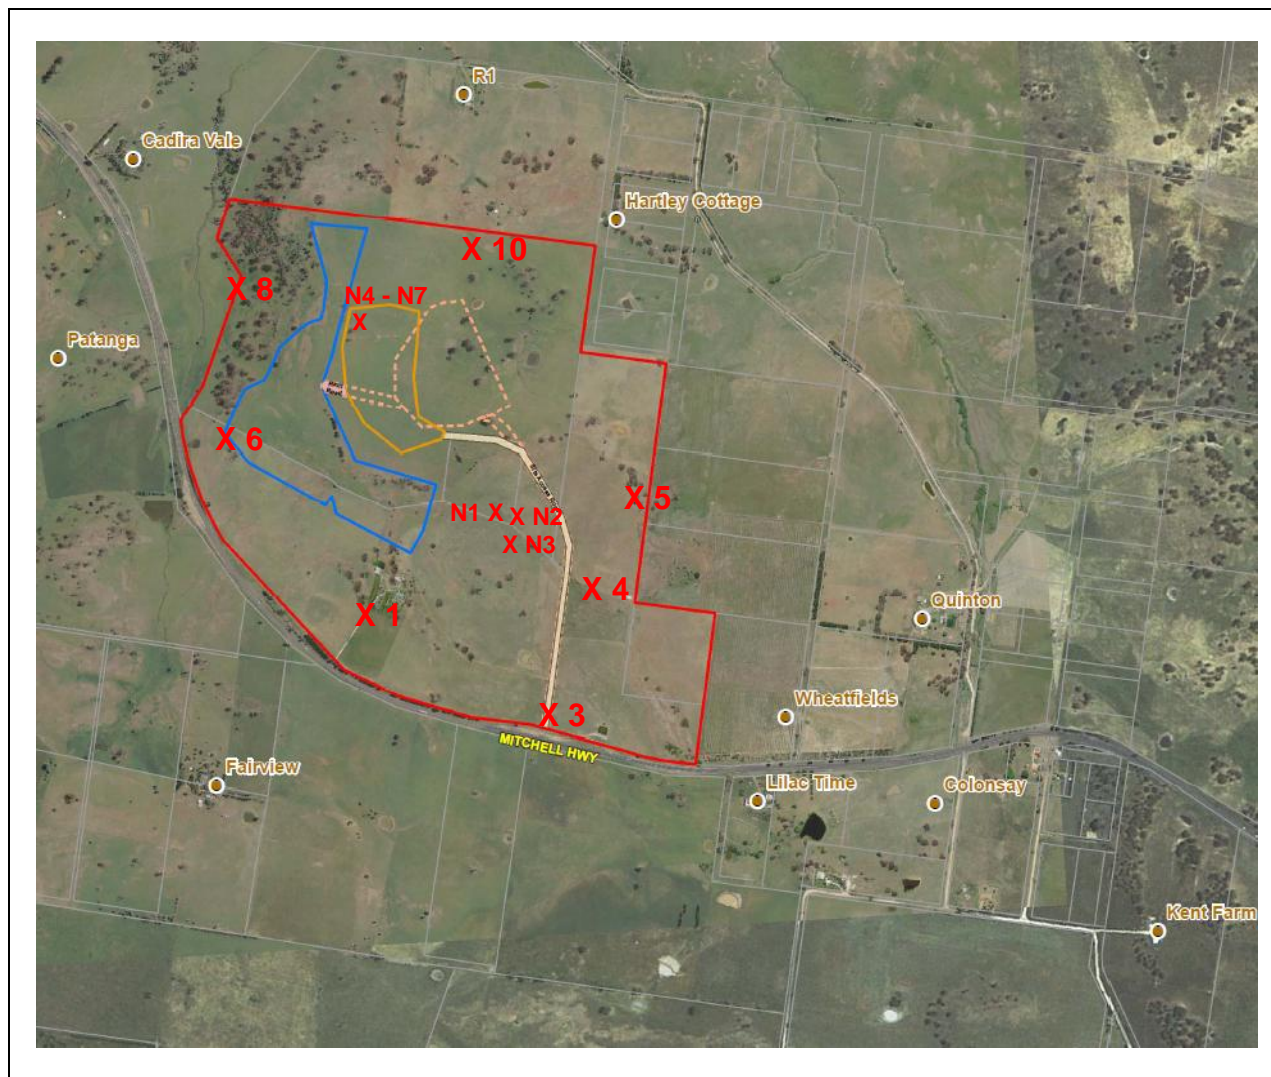

**Air Monitoring Sampling Plan
East Guyong Quarry Site**

Monitoring Date: 25th February 2013

Legend

- X 1 Air monitoring locations
- Project Boundary
- Proposed Quarry Boundary
- - - Proposed Infrastructure Area Boundary

Air Monitoring Location Coordinates

Location 1:	709,104mE ; 6300,660mN	Location N1:	709,380mE ; 6301,018mN
Location 3:	709,601mE ; 6300,370mN	Location N2:	709,446mE ; 6301,075mN
Location 4:	709,729mE ; 6300,716mN	Location N3:	709,452mE ; 6300,927mN
Location 5:	709,870mE ; 6300,905mN	Location N4:	709,159mE ; 6301,302mN
Location 6:	708,803mE ; 6301,185mN	Location N5:	709,046mE ; 6301,369mN
Location 8:	708,824mE ; 6301,587mN	Location N6:	709,071mE ; 6301,443mN
Location 10:	709,465mE ; 6301,633mN	Location N7:	709,206mE ; 6301,376mN

Weather Conditions*

<i>General</i>	Fine - Cloudy	<i>Wind Direction</i>	Mostly North
<i>Rainfall</i>	0.2 mm	<i>Wind Speed</i>	1 – 17 km/h

* East Guyong Quarry Weather Station