

CBased Environmental Pty Limited ABN 62 611 924 264



Calga Quarry

Environmental Monitoring

Dust Deposition, Surface Water, Groundwater and Meteorological Data

July 2022

Colin Davies BSc MEIA CENVP

Environmental Scientist Date: 19 August 2022

© CBased Environmental Pty Limited 2020. This document was prepared solely for the original recipient and no third party must rely on or use any information without the consent of CBased Environmental Pty Limited. CBased Environmental Pty Limited and the author accept no responsibility to any third party who uses or relies upon the information contained in this report.

Executive Summary

CBased Environmental is contracted by Hanson Quarry Products to conduct environmental monitoring at the Calga Sand Quarry.

The monitoring includes:

- Dust deposition;
- Surface water:
- Ground water and
- Meteorological data.

This report was prepared by CBased Environmental and includes the following results for July 2022:

- Dust deposition;
- Surface water quality; and
- Meteorological parameters;

The July 2022 dust deposition results for insoluble solids showed:

- Similar levels when compared to June 2022.
- Rolling annual averages below the Air Quality Management Plan criteria of 3.7g/m².month.

Monthly surface water samples were collected at sites A, B, C1, C2, D and F. The samples that were collected were analysed for a monthly sampling event. Results show pH within the slightly acidic range, low electrical conductivity, low total dissolved solids and low total suspended solids. Oil and grease were not detected at sites A, B, C1, C2, D and F in July 2022.

The Calga Quarry weather station data recovery in July 2022 was approximately 68% due to power outages. A summary of rainfall comparison is provided below.

Location	Rainfall (mm)
Calga Quarry	16.4mm
BOM Gosford*	448.8mm

Notes: NA = Not Available

*Data sourced from Bureau of Meteorology (BOM) website: www.bom.gov.au BOM stations report rainfall at 9am

Calga Quarry station reports rainfall at midnight.

1.0 Sampling Programme

Hanson Calga Quarry conducts environmental monitoring in accordance with Development Consent, OEH (EPA) licence and Environmental Management Plans. CBased Environmental are contracted to undertake dust deposition gauge, surface water, groundwater and meteorological monitoring for the project. CBased Environmental commenced monitoring from the April 2006 monitoring period.

Dust deposition gauges are operated to the Australian Standard AS3580.10.1 "Methods for sampling and analysis of ambient air method. Determination of particulates- deposited matter- gravimetric method". Sampling is undertaken every 30 +/- 2 days and each gauge is analysed for insoluble solids and ash residue. The results are reported as g/m².month.

Six (6) dust deposition gauges are monitored as follows:

- CD1 installed 1 May 2006. Gauges air quality impacts to the east of site operations;
- CD2c located on a rehabilitated section of land between the extraction area and adjacent resident. Gauges air quality impacts to the north of site operations. Replaces former gauges CD2a and CD2b;
- CD3 installed prior to May 2006. Gauges air quality impacts to the south of site operations;
- CD4 installed 3 October 2006. Gauges air quality impacts to the south of site operations;
- CD5 installed 14 December 2006. Gauges air quality impacts to the south of site operations; and
- CD6 installed 14 December 2006. Gauges air quality impacts to the south of the operations.

Dust gauge CD2a was discontinued at the start of August 2006 due to quarry operations "mining out" the site of the gauge. The replacement gauge, CD2b, was located in a position adjacent to the boundary between B. Kashouli and F. & J. Gazzana in conformance with the Air Quality Management Plan. CD2b was discontinued at the end of January 2010 due to contamination of the gauge by non-quarry related vehicle movements on a track adjacent to the gauge. CD2b was replacement by dust gauge CD2c.

Surface water is sampled in accordance with Australian Standards:

- AS5667.1 "Guidance on the design of sample programs, sampling techniques and the preservation and handling of samples";
- AS5667.6 "Water quality sampling—guidance on sampling of rivers and streams"; and
- AS5667.4 "Water quality sampling—guidance on sampling from lakes, natural and man-made".

Surface water monitoring sites include local streams and dams. Laboratory analysis includes pH, electrical conductivity, total suspended solids, total dissolved solids and total oil and grease. Monitoring is conducted monthly at Sites A and F (dams) and

when Sites B, C and D are flowing. Additional samples are collected when daily rainfall exceeds 50mm.

Groundwater is sampled in accordance with Australian Standards:

- AS5667.1 "Guidance on the design of sample programs, sampling techniques and the preservation and handling of samples"; and
- AS5667.11 "Water quality sampling—guidance on sampling of ground waters".

Groundwater monitoring sites are sampled bi-monthly for depth and water quality. Groundwater monitoring loggers continuously record water levels in a selection of bores.

Meteorological monitoring is conducted at the quarry and displayed on the site computer with a real-time display. Metrological parameters are measured according to Australian Standard AS3580.14 "Methods for sampling and analysis of ambient air. Meteorological monitoring for ambient air quality monitoring applications".

The weather station has the following sensor configuration:

- Air temperature;
- Humidity;
- Rainfall:
- Atmospheric pressure;
- Evaporation;
- Solar radiation;
- Wind speed; and
- Wind direction.

CBased Environmental continued to operate the monitoring equipment and utilise site collections at their existing locations.

The locations of monitoring points are provided in Figure 1.

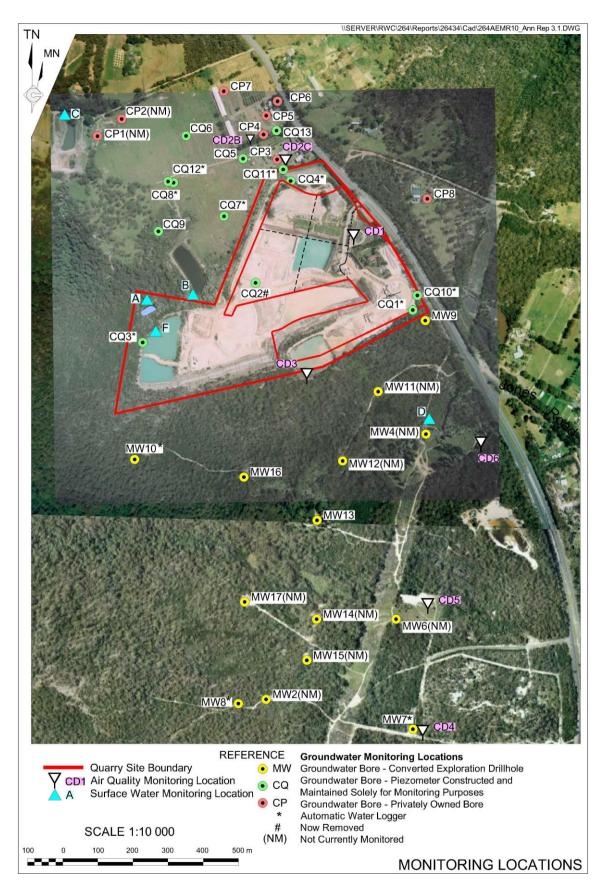


Figure 1: Hanson Calga Quarry Environmental Monitoring Locations

2.0 Results

2.1 Dust Deposition

The results for July 2022 and the project 12-month rolling average are provided **Table 1**.

Dust deposition charts for all dust gauge sites appear in **Figure 2** below. The field sheet, Chain of Custody documentation and laboratory analysis certificates are provided in **Appendix 1**.

Table 1: Dust Deposition Results: 01 July 2022 – 01 August 2022 (31 days)

Site	Monthly Insoluble Solids	Monthly Ash Residue	Monthly Combustible Matter	Monthly Ash Residue/ Insoluble Solids %	Rolling Annual Average Insoluble Solids
CD1	1.3	0.4	0.9	31	2.0
CD2c	0.3	0.1	0.2	33	0.9
CD3	0.6	0.3	0.3	50	1.5
CD4	0.4	0.2	0.2	50	0.8
CD5	0.2	0.1	0.1	50	0.6
CD6	0.2	0.1	0.1	50	0.5

Notes:

Units in g/m².month unless indicated

Insoluble solid results marked with an * indicate an excessively contaminated gauge. Contamination can include bird droppings, vegetation (such as plant matter, algae, pollen and seeds) and insects Results in **bold** indicate insoluble solids levels above 3.7g/m².month; the Development Consent's annual average amenity criteria at residential locations

The current rolling annual average is calculated from August 2021 to July 2022

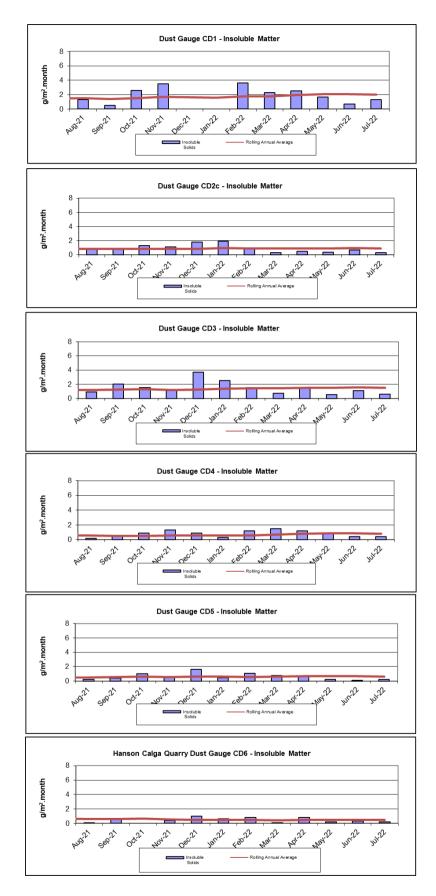


Figure 2: Summary Monthly/Annual Dust Deposition Results for Insoluble Solids

2.2 Surface Water (Monthly)

Monthly surface water monitoring was conducted on 01 July 2022 and results are provided in **Table 2**. The field sheet, chain of custody documentation and laboratory analysis certificates are provided in **Appendix 1**.

Samples were collected at sites A, B, C1, C2, D and F.

 Table 2:
 Monthly Surface Water Monitoring Results – July 2022

Site	Observed Flow Rate* (visual)	Water Colour* (visual)	Turbidity* (visual)	рН	EC (μS/cm)	TDS (mg/L)	TSS (mg/L)	Oil and Grease (mg/L)
Α	Still	Colourless	Clear	5.96	66	37	<5	<5
В	Trickle	Brown	Slight	6.58	87	62	6	<5
C1	Dam	Brown	Slight	6.59	81	70	9	<5
C2	Steady	Colourless	Clear	6.34	102	71	5	<5
D	Trickle	Brown	Clear	5.86	97	64	21	<5
F	Dam	Colourless	Clear	5.59	65	37	11	<5

^{*} Indicates field measurements. All other results are laboratory analysed

2.2.1 Non-Routine Surface Water Sampling

No non-routine surface water sampling was completed in July 2022.

EC = Electrical conductivity

TDS = Total dissolved solids

TSS = Total suspended solids

2.3 Meteorological Data

The Calga Quarry weather station data recovery for July 2022 was approximately 68 due to power outages%.

The weather station data follows and includes:

- Monthly rainfall comparison between quarry data and BOM data. Refer to Table 4;
- Monthly data summary. Refer to Table 5;
- Weather charts of air temperature, humidity, heat index and wind chill, atmospheric pressure, solar radiation, evapotranspiration, rain, wind speed and data reception. Refer to **Figures 7 10**; and
- Wind rose (frequency distribution diagram of wind speed and direction). Refer to Figure 10.

A summary of rainfall comparison is provided in **Table 4**.

Table 4: Comparison of Local Rainfall – July 2022

Location	Rainfall (mm)
Calga Quarry	16.4mm
BOM Gosford*	448.8mm

Notes: NA = Not Available

*Data sourced from Bureau of Meteorology (BOM) website: www.bom.gov.au BOM stations report rainfall at 9am

Calga Quarry station reports rainfall at midnight.

 Table 5:
 Summary of Monthly Meteorological Data – July 2022

Date	Temperature Min	Temperature Avg	Temperature Max	Relative Humidity Min		Relative Humidity Max	Rain	Evapotrans piration	Wind Speed Min	Wind Speed Avg	Wind Speed Max	Wind Chill Min	Heat Index Max	Atmospheric Pressure Min	Atmospheric Pressure Avg	Atmospheric Pressure Max	Solar Radiation Min	Solar Radiation Avg	Solar Radiation Max	Data Min	Data Avg	Data Max
1/07/2021	8.7	12.2	16.3	86.0	95.6	99.0	1.8	0.8	0.0	1.1	17.7	8.7	16.4	1015.0	1020.0	1023.6	0.0	67.8	551.0	0.0	32.0	52.4
2/07/2021	11.3	14.1	18.8	73.0	86.3	97.0	1.6	1.8	0.0	4.2	27.4	10.9	18.8	1012.9	1014.6	1015.9	0.0	118.2	579.0	0.0	35.1	55.2
3/07/2021	7.7	12.2	18.7	54.0	81.0	94.0	0.0	1.9	0.0	2.6	16.1	7.7	18.3	1012.6	1014.6	1016.4	0.0	131.2	550.0	15.5	38.8	90.9
4/07/2021	4.0	9.1	14.0	56.0	73.3	91.0	0.0	2.2	0.0	5.7	24.1	2.4	13.1	1015.7	1018.0	1020.2	0.0	135.9	562.0	38.5	46.9	56.2
5/07/2021	3.1	8.0	15.4	55.0	77.2	92.0	0.0	1.3	0.0	3.0	20.9	3.2	14.5	1015.3	1017.2	1018.5	0.0	98.2	555.0	0.0	49.5	96.2
6/07/2021	2.2	7.9	14.9	58.0	80.2	94.0	0.0	1.7	0.0	1.6	14.5	2.2	14.0	1016.4	1018.3	1020.3	0.0	124.6	565.0	19.2	64.2	92.1
7/07/2021	3.1	8.4	15.8	61.0	84.3	95.0	0.0	1.6	0.0	1.2	11.3	3.2	14.9	1020.1	1021.3	1023.4	0.0	114.1	565.0	43.8	75.7	91.2
8/07/2021	3.7	9.3	16.2	73.0	87.5	97.0	0.0	1.3	0.0	1.5	14.5	3.8	15.8	1015.6	1019.0	1021.8	0.0	100.1	497.0	28.7	71.0	92.1
9/07/2021	7.6	9.4	10.8	90.0	95.9	97.0	8.6	0.3	0.0	4.2	32.2	7.4	11.0	1008.4	1010.8	1015.1	0.0	21.5	131.0	16.1	51.7	78.2
10/07/2021	9.8	11.3	13.1	80.0	86.4	96.0	3.2	1.1	4.8	14.4	48.3	7.6	12.8	1008.9	1014.9	1020.9	0.0	45.0	250.0	57.4	79.3	92.7
11/07/2021	8.3	10.5	15.9	76.0	91.3	96.0	0.8	1.1	0.0	3.1	27.4	8.1	15.4	1020.8	1022.2	1024.3	0.0	88.9	633.0	56.2	77.6	90.9
12/07/2021	4.7	10.3	17.3	70.0	88.7	98.0	0.2	1.8	0.0	3.1	22.5	4.8	17.1	1016.4	1019.2	1021.9	0.0	125.8	695.0	34.4	71.2	95.9
13/07/2021	7.4	12.3	18.4	60.0	79.4	93.0	0.0	2.1	0.0	3.9	22.5	7.4	17.9	1012.8	1014.8	1016.8	0.0	130.0	602.0	57.7	82.7	100.0
14/07/2021	10.2	12.8	15.4	70.0	76.1	85.0	0.2	0.9	0.0	4.0	24.1	10.3	15.1	1004.5	1009.1	1012.9	0.0	27.4	178.0	0.0	54.9	83.0
15/07/2021																						
16/07/2021																						
17/07/2021																						
18/07/2021																						
19/07/2021																						
20/07/2021																						
21/07/2021																						
22/07/2021																						
23/07/2021																						
24/07/2021																						
25/07/2021	9.4	11.2	13.9	43.0	57.4	72.0	0.0	4.2	11.3	21.3	59.5	5.7	12.6	998.0	1004.6	1011.4	0.0	144.1	738.0	60.3	70.5	81.1
26/07/2021	8.3	13.0	18.8	47.0	64.1	75.0	0.0	3.8	8.0	15.9	57.9	5.7	17.8	1010.4	1012.5	1014.9	0.0	154.0	628.0	36.3	65.4	87.1
27/07/2021	11.3	14.4	19.4	50.0	66.0	79.0	0.0	3.0	1.6	8.7	38.6	10.1	18.4	1009.8	1013.9	1017.0	0.0	152.5	656.0	31.9	58.6	73.5
28/07/2021	12.9	16.4	23.8	37.0	55.5	71.0	0.0	4.5	0.0	16.3	57.9	11.6	23.1	1000.8	1004.6	1010.0	0.0	134.3	600.0	0.0	55.3	80.8
29/07/2021	8.2	12.2	17.8	28.0	57.0	71.0	0.0	2.1	0.0	6.4	35.4	8.0	15.9	1004.0	1010.4	1015.9	0.0	101.2	617.0	0.0	38.4	66.9
30/07/2021	3.8	11.1	19.9	34.0	58.8	85.0	0.0	2.8	0.0	2.6	16.1	3.9	18.4	1013.9	1015.9	1018.2	0.0	163.2	643.0	12.9	46.2	70.0
31/07/2021	7.6	15.2	22.5	43.0	54.0	68.0	0.0	2.9	0.0	4.4	32.2	7.7	21.7	1005.5	1009.7	1014.2	0.0	129.0	663.0	42.6	54.7	72.2
Monthly	2.2	11.5	23.8	28	76	99	16.4	43.0	0.0	6.2	59.5	2.2	23.1	998.0	1014.6	1024.3	0.0	109.9	738.0	0.0	58.1	100.0
Unit	De	grees Celcius (°C)	Percentag	ge Relative	Humidity	mm	mm	Metres	per secon	d (m/s)	°C	°C	He	ector Pascals (hi	Pa)	Watts pe	r square metr	re (W/m²)	F	ercentage (%)
	No data for 15 - 24 July 2022 due to power outages														_							

No data for 15 - 24 July 2022 due to power outages

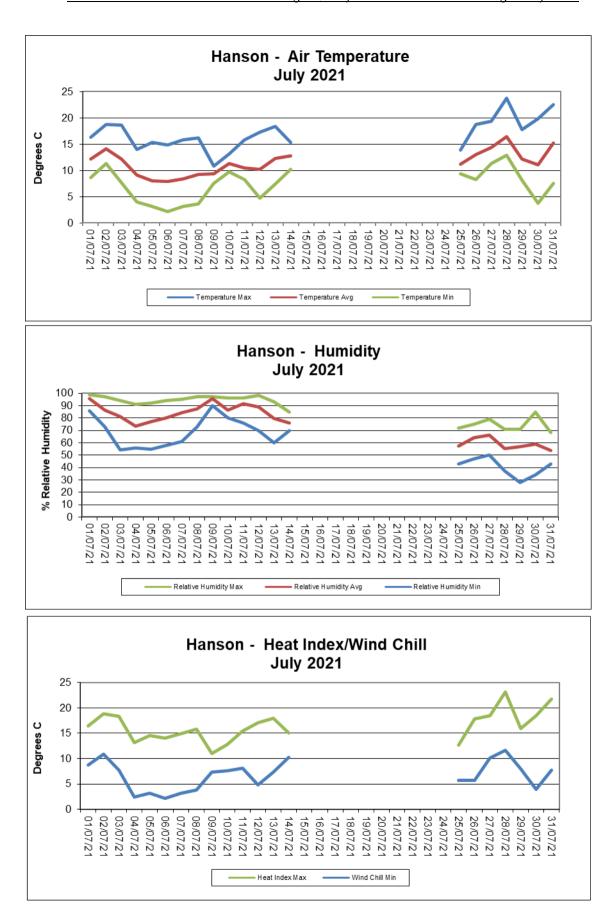
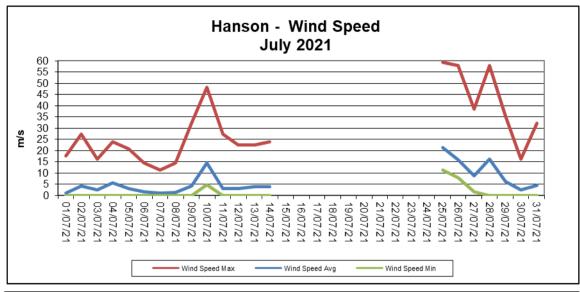
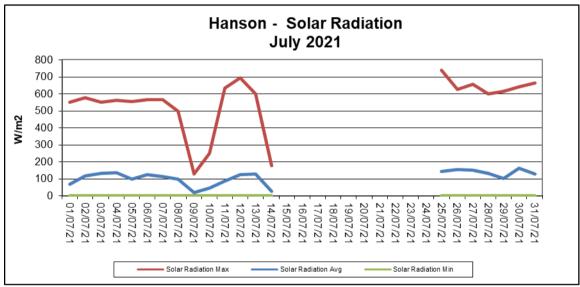


Figure 7: Summary of Monthly Temperature, Humidity and Heat Index Results





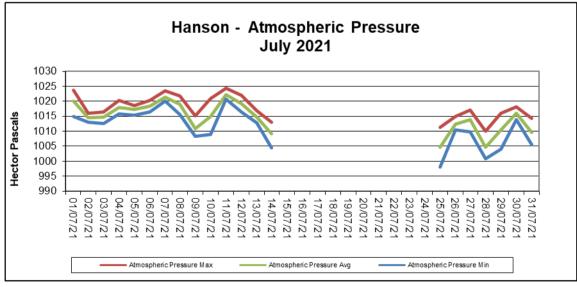
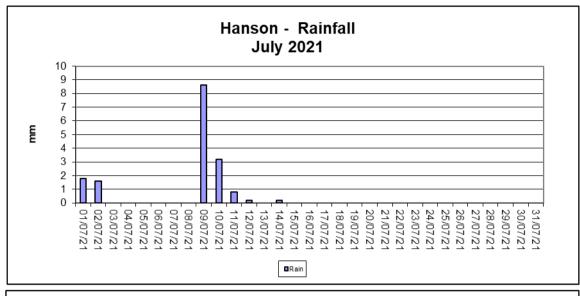
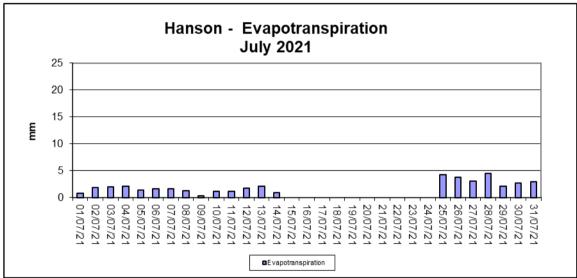


Figure 8: Summary of Monthly Wind Speed, Solar Radiation and Atmospheric Pressure Results





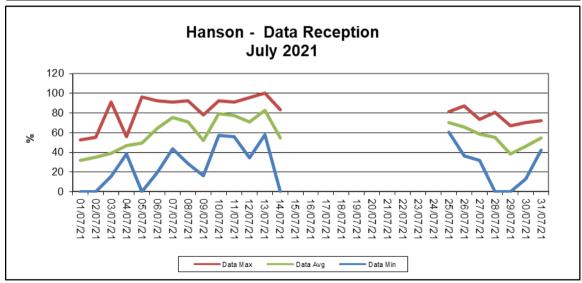


Figure 9: Summary of Monthly Rainfall, Evapotranspiration and Data Reception Results

Frequency plot of the average wind speed and average direction over each 15-minute sampling period. Wind is considered to be calm when at less than a 15-minute average of 1m/s.

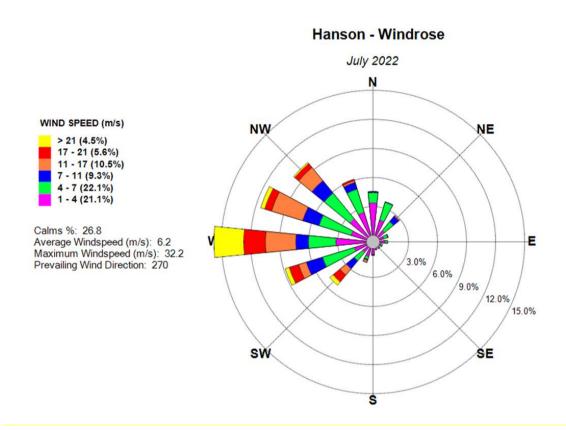


Figure 10: Monthly Windrose Plot – July 2022

The predominant wind for July 2022 was from the West with most frequent, strongest winds, also from the West. The highest wind speed was 59.5 m/s from the West.

Appendix 1

Field Sheets
Chain of Custody Documentation
Laboratory Analysis Certificates



Client: Hanson Calga Quarry

Date Installed: 1-7-22

Sampled By: Sm AL

Site	Time	Water	Insolu	ble Material (🗸 =	slight, 🗸 🗸 = m	od etc)	Water	Water	Stand Level	Funnel Level	Funnel	New Funnel	Comments
	Collected	Level (mL)	Insects	Bird droppings	Vegetation	Dust	Turbidity	Colour	(Y/N)	(Y/N)	Diameter (mm)	Diameter (mm)*	70-2-7700 MACAGAN 1-2-7-7-7-7-7-7-7-7-7-7-7-7-7-7-7-7-7-7-
CD1	10-30	1980	/		111	/	CS T	C O BriGn Gy	Y	Y	150		
CD2C	10.40	1900	_			/	⊘ S T	Bn Gn Gy	×	Y	150		
CD3	10-25	1999			/	/	€\$ T	O Bn Gn Gy	7	Y	150		
CD4	13-25	1999			11	1	CS T	O Bn Gn Gy	Y	Y	150		
CD5	13-45	1999	/		/	-	⊘ ST	©O Bn Gn Gy	7	y	150		
CD6	14.00	1960	/		/	/	€ 8 T	😂 Bn Gn Gy	7	Y	150		
9													
						9							
	٠				0								

Turbidity: C=Clear, S= Slight, T=Turbid (CIRCLE)

Colour: C=Colourless, O=Orange, Bn=Brown, Gn=Green, Gy = Grey (CIRCLE)

*Record new funnel diameter whenever funnel is replaced and update on COC

CHAIN OF CUSTO	DDY DC	CL	JME	ENT	AT	ION																Aust	ralian Laboratory
CLIENT: CBased Environmental Pty L	td							LABC	RAT	DRY E	ATCH N	O.:			4.47							Serv	ices Pty Ltd
POSTAL ADDRESS: PO Box 245 Ces	snock NSW 23	325			Western e			SAME	LER	S:	8	M	AL	-									All and the second seco
SEND REPORT TO: monitoringresults@cbased.com.au		SENI	D INVO	DICE T	O: acco	ounts@cbased.com.au		PHON						IL: moni	toringre	esults@	gcbas	ed.cor	m.au			-	
DATA NEEDED BY: 7 working days		REP	ORT N	EEDE	D BY: 7	7 working days		REPO	RT F	ORM	AT: HAF	RD: Yes	FA	X:	DIS	SK:	BUI	LLETI	N BOA	ARD:	E	MAIL:	Yes
PROJECT ID: Hanson Calga Dusts	QUOTE NO.:							QC LI	EVEL	:	QCS1:			QCS2:		Q	CS3:	Yes			QCS	4:	
P.O. NO.:	COMMENTS	SPECI	IAL HA	NDLIN	G/STO	RAGE OR DIPOSAL:									AN	ALYSI	SREC	QUIRE	D				
FOR LAB USE ONLY COOLER SEAL								Soldis	ne	e Matte													
Yes 72 No	Total unless s	pecifie	ed .					nsoluable	Ash Residue	Combustable					1 1		ı		- 1				
Broken V Intact								olu	8	뤝					1 1				- 1				
COOLER TEMP: deg.C				11.00	54.			ᆵ	As	ပိ													NOTES
SAMP	LE DATA					CONTAINER				_													
SAMPLE ID	MATRIX					TYPE & PRESERVATIVE	Funnel Diameter (mm)																
CD1	Dust	1.7	.22	1.8	.22	1x dust gauge jar	150	х	x	х													
CD2c	Dust)	1		1x dust gauge jar	150	х	х	х						0							
CD3	Dust					1x dust gauge jar	150	х	х	х													
CD4	Dust					1x dust gauge jar	150	х	х	х												i i	
CD5	Dust					1x dust gauge jar	150	х	х	х													
CD6	Dust					1x dust gauge jar	150	х	х	х			3										
						· .																	
and the second s																	_						
		_								_							_						
		-								<u> </u>		\perp					_						
		_														_			_				
		-			_					-		_		_	\vdash	-	_	_	_				
		-								_					\vdash	_	_	_	_				
	<u> </u>														$\sqcup \bot$								
A U		RELIN	QUISH	ED BY		20/00							R	ECEIVE	D BY								HOD OF SHIPMENT
	ecs, s				DATE			NAME	: 7	B										8/2		CON	SIGNMENT NOTE NO.
OF: CBased Environmental					TIME:	1400		OF:∌										TIME		57	em.		
NAME :					DATE			NAME		_								DATE:				TRAN	ISPORT CO. NAME.
OF:					TIM			OF:			A : 1 D'							TIME				L	
*Container Type and Preservative Cod																			ottle;				
VC = Hydrochloric Acid Preserved Vial	ı; VS = Sulfuric	Acid P	reserv	ed Vial	; BS =	Sulfuric Acid Preserved Gl	ass Bottle; Z = Zind	Aceta	te Pre	serve	a Bottle;	E = EDT	A Prese	rved Bo	ttles; S	ı = Ste	enie B	ottle:	-		mont		ivicion
O = Other.			103																	VILOL	ment	al D	ivision

AUSTRALIAN LABORATORY SERVICES P/L

Environmental Division
Newcastle
Work Order Reference
EN2207428



Telephone: +61 2 4014 2500



CERTIFICATE OF ANALYSIS

Work Order : EN2207428

: CBASED ENVIRONMENTAL PTY LTD

Contact : All Deliverables

Address : Unit 3 2 Enterprise Cres

Singleton NSW 2330

Telephone : +61 02 6571 3334 **Project** : Hanson Calga Dusts

Order number C-O-C number

Sampler : SM & AL

Site

Client

Quote number : SYBQ/403/21 and PLANNED EVENTS

No. of samples received : 6 : 6 No. of samples analysed

Page : 1 of 4

> Laboratory : Environmental Division Newcastle

Contact

Address : 5/585 Maitland Road Mayfield West NSW Australia 2304

Telephone : +61 2 4014 2500 **Date Samples Received** : 02-Aug-2022 13:57 **Date Analysis Commenced** : 03-Aug-2022

Issue Date : 11-Aug-2022 11:27



ISO/IEC 17025 - Testing

This report supersedes any previous report(s) with this reference. Results apply to the sample(s) as submitted, unless the sampling was conducted by ALS. This document shall not be reproduced, except in full

This Certificate of Analysis contains the following information:

- General Comments
- Analytical Results

Additional information pertinent to this report will be found in the following separate attachments: Quality Control Report, QA/QC Compliance Assessment to assist with **Quality Review and Sample Receipt Notification.**

Signatories

This document has been electronically signed by the authorized signatories below. Electronic signing is carried out in compliance with procedures specified in 21 CFR Part 11.

Signatories Position Accreditation Category

Thomas Regan Laboratory Technician Newcastle - Inorganics, Mayfield West, NSW Page : 2 of 4
Work Order : EN2207428

Client : CBASED ENVIRONMENTAL PTY LTD

Project : Hanson Calga Dusts



General Comments

The analytical procedures used by ALS have been developed from established internationally recognised procedures such as those published by the USEPA, APHA, AS and NEPM. In house developed procedures are fully validated and are often at the client request.

Where moisture determination has been performed, results are reported on a dry weight basis.

Where a reported less than (<) result is higher than the LOR, this may be due to primary sample extract/digestate dilution and/or insufficient sample for analysis.

Where the LOR of a reported result differs from standard LOR, this may be due to high moisture content, insufficient sample (reduced weight employed) or matrix interference.

When sampling time information is not provided by the client, sampling dates are shown without a time component. In these instances, the time component has been assumed by the laboratory for processing purposes.

Where a result is required to meet compliance limits the associated uncertainty must be considered. Refer to the ALS Contract for details.

Key: CAS Number = CAS registry number from database maintained by Chemical Abstracts Services. The Chemical Abstracts Service is a division of the American Chemical Society.

LOR = Limit of reporting


- ^ = This result is computed from individual analyte detections at or above the level of reporting
- ø = ALS is not NATA accredited for these tests.
- ~ = Indicates an estimated value.
- Analysis as per AS3580.10.1-2016. Samples passed through a 1mm sieve prior to analysis. NATA accreditation does not apply for results reported in g/m².mth as sampling data was provided by the client.
- The dust gauges for samples 004 006 were full when received by the laboratory. They may have overflowed in the field. Results for these gauges are thus reported on an 'as received' basis.
- For dust analysis, the Limit of Reporting (LOR) referenced in the reports for deposited matter parameters represents the reporting increment rather than reporting limit.

Page : 3 of 4
Work Order : EN2207428

Client : CBASED ENVIRONMENTAL PTY LTD

Project : Hanson Calga Dusts

Analytical Results

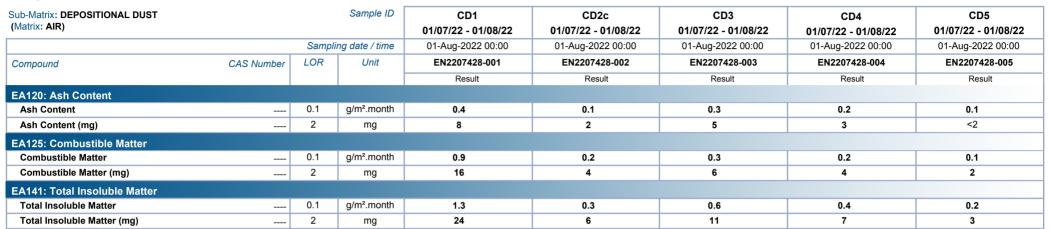




Page : 4 of 4
Work Order : EN2207428

Client : CBASED ENVIRONMENTAL PTY LTD

Project : Hanson Calga Dusts

Analytical Results

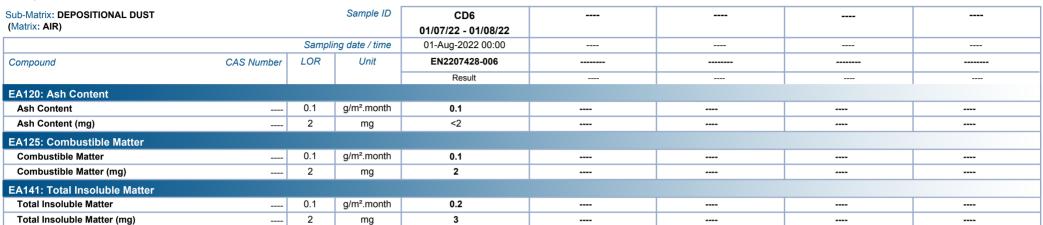



CBASED ENVIRONMENTAL PTY LIMITED



Date: 01.07.22

Client :

Hanson Calga

Project:

SURFACE WATERS

Site	Flow Rate	Odour	Sampling Time	Bottles	Water Turbidity	Water Colour	Comments
\	Still	N	0815	1x 250ml GP, 1x 500mL GP, 1x PG	⊘ S T	(CLO O B G	
	Trickle	N	0830	1x 250ml GP, 1x 500mL GP, 1x PG	CST	C LO OBG	
:1	DAM	~	9.50	1x 250ml GP, 1x 500mL GP, 1x PG	CST	CLOORG	
2	STEADY	~	9.55	1x 250ml GP, 1x 500mL GP, 1x PG	©S T	© LO O B G	
)	TRICKLE	N	0925	1x 250ml GP, 1x 500mL GP, 1x PG	CS T	CLOQBG	
	Dan	N	0810	1x 250ml GP, 1x 500mL GP, 1x PG	CS T	€ LO O B G	

Turbidity: C=Clear, S= Slight, T=Turbid (CIRCLE)

Compled by

an + po

Colour: C=Clear, LO=Light Orange, O=Orange, B=Brown, G=Green (CIRCLE)

CHAIN OF CUSTO	HAIN OF CUSTODY DOCUMENTATION																Austra	lian Laboratory						
CLIENT: CBased Environmental Pty	Ltd					LABO	DRAT	ORY I	ватс	HNO		30 4	CHAIR CAN		e de				# T		1		Servic	es Pty Ltd
POSTAL ADDRESS: PO Box 245 C	ESSNOCK NS	SW 2325	200740000			SAMI	PLER	S:CB	ased	Enviro	nment	al Pty	Ltd											
SEND REPORT TO: monitoringresults@cbased.com.au		SEND IN' accounts(D: renae.mikka@cbased.com.au; .com.au		PHO	NE: 0	26571	3334		N.	E-N	IAIL: m	onitori	ngresult	s@cba	ased.c	om.au	V.					,
DATA NEEDED BY: 5 working days		REPORT	NEEDED	BY: 5 working days		REPO	ORT F	FORM	AT:	HARD	: Yes		FAX:		DISK:	Е	ULLE	TIN BO	ARD:		E-MAIL	: Yes		
PROJECT ID: Hanson Quarry SW	QUOTE NO.	: SYBQ-403	-18		114211111111	QC L	C LEVEL: QCS1: QCS2: QCS3: Yes QCS4:									4:								
P.O. NO.:	COMMENTS	SPECIAL I	HANDLIN	G/STORAGE OR DIPOSAL:												ANAL	YSIS	REQUIF	RED		200-12			
FOR LAB USE ONLY COOLER SEAL																							- (a)	
Yes \\ \O\ No	Total unless	specified		210		1		1					- 4											
Broken \ \ Intact						1		(0)	₀	Ö			- 1		1 1								1 1	· ·
COOLER TEMP: deg.C						표	E	TSS	TDS	0													l N	OTES
SAMPL	E DATA			CONTAINER DATA																				
SAMPLE ID	MATRIX	DATE	TIME	TYPE & PRESERVATIVE	NO.																	U.		
Α	Water	1.07.2	1 0815	1x 250mlGP,1x 500mLGP,1xPG	;	х	х	х	х	х														
В	Water			1x 250mlGP,1x 500mLGP,1xPG		х	х	х	_															
C1	Water		0950	1x 250mlGP,1x 500mLGP,1xPG		х	х	х	х	х														
C2	Water		0955	1x 250mlGP,1x 500mLGP,1xPG	i	х	х	х	х	х														
D	Water			1x 250mlGP,1x 500mLGP,1xPG		х	х	х	х	х														
F	Water	<u> </u>	0810	1x 250mlGP,1x 500mLGP,1xPG		Х	х	Х	х	Х														
															8									
								_																
							18						_	_	\perp									
													_		\perp									
	ļ		-			-	-	-			\vdash	_	_	_	1		_	_			\vdash			
	ļ					-		-	_	\vdash	-	-		_	+			_	_		\vdash			
	-	-											-		-		_							
· · · · · · · · · · · · · · · · · · ·	1		l.,	TOTAL BOTTLES:											لــــــــــــــــــــــــــــــــــــــ					-				
	REL	.INQUISHE) BY: /-	Lowis .		ł	- 521	191				RE	CEIVE	D BY				1-						D OF SHIPMENT
NAME :				TE: 1.7.22		NAME (CC) DATE: 1/7								CONSI	GNMENT NOTE NO.									
OF: CBased Environmental				TIME: 1140		OF: ALS TIME: 140 NAME: DATE:																		
NAME :		-		DATE:										TRANS	PORT CO. NAME.									
OF:		1 D1 11 1		TIME:			10.60	0.1				W W		0.1			TIME:						1	
*Container Type and Preservative Co VC = Hydrochloric Acid Preserved Vi																				ue,				

AUSTRALIAN LABORATORY SERVICES P/L

Environmental Division
Newcastle - Water
Work Order Reference
WN2207610

O = Other.



Telephone: +61 2 4014 2500



CERTIFICATE OF ANALYSIS

Work Order : WN2207610

Laboratory : CBASED ENVIRONMENTAL PTY LTD

Contact : All Deliverables Contact : Andrea Swan

Address · 5/585 Maitland Road Newcastle West NSW Australia 2304 Address : Unit 3 2 Enterprise Cres

Singleton NSW 2330

Telephone : +61 02 6571 3334 Telephone : +61 2 4014 2500 **Date Samples Received Project** : Hanson Quarry SW : 01-Jul-2022 11:40

Order number

Sampler CARBON BASED ENVIRONMENTAL PTY LTD

Site

Client

C-O-C number

Quote number : SYBQ/403/18

No. of samples received : 6 : 6 No. of samples analysed

Page : 1 of 4

: ALS Water - Newcastle

Date Analysis Commenced : 01-Jul-2022

Issue Date : 08-Jul-2022 13:48



ISO/IEC 17025 - Testing

This report supersedes any previous report(s) with this reference. Results apply to the sample(s) as submitted, unless the sampling was conducted by ALS. This document shall not be reproduced, except in full

This Certificate of Analysis contains the following information:

- General Comments
- Analytical Results

Additional information pertinent to this report will be found in the following separate attachments: Quality Control Report, QA/QC Compliance Assessment to assist with **Quality Review and Sample Receipt Notification.**

Signatories

This document has been electronically signed by the authorized signatories below. Electronic signing is carried out in compliance with procedures specified in 21 CFR Part 11.

Signatories Accreditation Category

Ankit Joshi Senior Chemist - Inorganics Sydney Inorganics, Smithfield, NSW Neil Martin Team Leader - Chemistry Chemistry, Newcastle West, NSW

Page : 2 of 4

Work Order : WN2207610

Client : CBASED ENVIRONMENTAL PTY LTD

Project : Hanson Quarry SW

General Comments

The analytical procedures used by ALS have been developed from established internationally recognised procedures such as those published by the USEPA, APHA, AS and NEPM. In house developed procedures are fully validated and are often at the client request.

Where moisture determination has been performed, results are reported on a dry weight basis.

Where a reported less than (<) result is higher than the LOR, this may be due to primary sample extract/digestate dilution and/or insufficient sample for analysis.

Where the LOR of a reported result differs from standard LOR, this may be due to high moisture content, insufficient sample (reduced weight employed) or matrix interference.

When sampling time information is not provided by the client, sampling dates are shown without a time component. In these instances, the time component has been assumed by the laboratory for processing purposes.

Where a result is required to meet compliance limits the associated uncertainty must be considered. Refer to the ALS Contract for details.

Key: CAS Number = CAS registry number from database maintained by Chemical Abstracts Services. The Chemical Abstracts Service is a division of the American Chemical Society.

LOR = Limit of reporting

^ = This result is computed from individual analyte detections at or above the level of reporting

ø = ALS is not NATA accredited for these tests.

~ = Indicates an estimated value.

EP020 conducted by ALS Sydney, NATA accreditation no. 825, site no 10911.



Page : 3 of 4
Work Order : WN2207610

EP020: Oil and Grease (O&G)

Oil & Grease

Client : CBASED ENVIRONMENTAL PTY LTD


5

mg/L

<5

Project : Hanson Quarry SW

Analytical Results

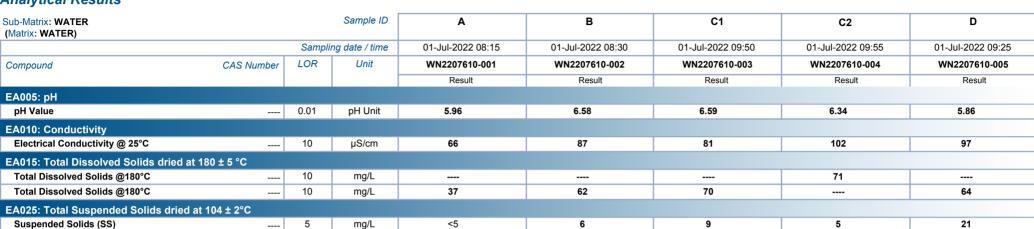

<5

<5



<5

<5

Page : 4 of 4

: WN2207610 Work Order

: CBASED ENVIRONMENTAL PTY LTD Client

Project Hanson Quarry SW

Analytical Results



Sub-Matrix: WATER (Matrix: WATER)			Sample ID	F	 	
		Sampli	ng date / time	01-Jul-2022 08:10	 	
Compound	CAS Number	LOR	Unit	WN2207610-006	 	
				Result	 	
EA005: pH						
pH Value		0.01	pH Unit	5.59	 	
EA010: Conductivity						
Electrical Conductivity @ 25°C		10	μS/cm	65	 	
EA015: Total Dissolved Solids dried at 18	30 ± 5 °C					
Total Dissolved Solids @180°C		10	mg/L	37	 	
EA025: Total Suspended Solids dried at	104 ± 2°C					
Suspended Solids (SS)		5	mg/L	11	 	
EP020: Oil and Grease (O&G)						
Oil & Grease		5	mg/L	<5	 	

Inter-Laboratory Testing
Analysis conducted by ALS Sydney, NATA accreditation no. 825, site no. 10911 (Chemistry) 14913 (Biology).

(WATER) EP020: Oil and Grease (O&G)